



# SAFETY DATA SHEET

## 1. PRODUCT AND COMPANY IDENTIFICATION

Product Name: Innershield® NR®-211-MP

**Product Size:** .035" (0.9 mm)

Other means of identification

**SDS number:** 20000000130

Recommended use and restriction on use

**Recommended use:** FCAW-S (Self-Shielded Flux Cored Arc Welding) **Restrictions on use:** Not known. Read this SDS before using this product.

Manufacturer/Importer/Supplier/Distributor Information

Company Name: The Lincoln Electric Company Address: 22801 Saint Clair Avenue Cleveland, Ohio 44117

USA

Telephone: +1 (216) 481-8100

Contact Person: Safety Data Sheet Questions: www.lincolnelectric.com/sds

Arc Welding Safety Information: www.lincolnelectric.com/safety

Company Name: The Lincoln Electric Company of Canada LP

Address: 179 Wicksteed Avenue

Toronto, Ontario M4G 2B9

Canada

Telephone: +1 (416) 421-2600

Contact Person: Safety Data Sheet Questions: www.lincolnelectric.com/sds

Arc Welding Safety Information: www.lincolnelectric.com/safety

# **Emergency telephone number:**

USA/Canada/Mexico +1 (888) 609-1762 Americas/Europe +1 (216) 383-8962 Asia Pacific +1 (216) 383-8966 Middle East/Africa +1 (216) 383-8969

3E Company Access Code: 333988

### 2. HAZARDS IDENTIFICATION

Classified according to the criteria of the Globally Harmonized System of Classification and Labeling of Chemicals (GHS), The United States Occupational Safety and Health Administration's Hazard Communication Standard (29 CFR 1910.1200), Canada's Hazardous Product Regulations and Mexico's Harmonized System for the Identification and Communication of Hazards and Risks from Hazardous Chemicals in the Workplace.

Hazard Classification Not classified as hazardous according to applicable GHS hazard classification

criteria.

**Label Elements** 

Hazard Symbol: No symbol

Signal Word: No signal word.

Hazard Statement: Not applicable

Precautionary Not applicable



#### Statements:

# Other hazards which do not result in GHS classification:

Electrical Shock can kill. If welding must be performed in damp locations or with wet clothing, on metal structures or when in cramped positions such as sitting, kneeling or lying, or if there is a high risk of unavoidable or accidental contact with work piece, use the following equipment: Semiautomatic DC Welder, DC Manual (Stick) Welder, or AC Welder with Reduced Voltage Control.

Arc rays can injure eyes and burn skin. Welding arc and sparks can ignite combustibles and flammable materials. Overexposure to welding fumes and gases can be hazardous. Read and understand the manufacturer's instructions, Safety Data Sheets and the precautionary labels before using this product. Refer to Section 8.

# Substance(s) formed under the conditions of use:

The welding fume produced from this welding electrode may contain the following constituent(s) and/or their complex metallic oxides as well as solid particles or other constituents from the consumables, base metal, or base metal coating not listed below.

Chemical Identity	CAS-No.
Carbon dioxide	124-38-9
Carbon monoxide	630-08-0
Nitrogen dioxide	10102-44-0
Ozone	10028-15-6
Manganese	7439-96-5
Barium and soluble compounds (as Ba)	7440-39-3
Fluorides (as F)	16984-48-8

# 3. COMPOSITION / INFORMATION ON INGREDIENTS

# **Reportable Hazardous Ingredients Mixtures**

Chemical Identity	CAS number	Content in percent (%)*
Iron	7439-89-6	50 - <100%
Barium fluoride	7787-32-8	1 - <5%
Aluminum and/or aluminum alloys (as Al)	7429-90-5	1 - <5%
Portland cement	65997-15-1	0.1 - <1%
Magnesium	7439-95-4	0.1 - <1%
Manganese	7439-96-5	0.1 - <1%
Lithium fluoride	7789-24-4	0.1 - <1%
Potassium fluorosilicate	16871-90-2	0.1 - <1%
Silicon	7440-21-3	0.1 - <1%

<sup>\*</sup> All concentrations are percent by weight unless ingredient is a gas. Gas concentrations are in percent by volume.

#### **Composition Comments:**

The term "Hazardous Ingredients" should be interpreted as a term defined in Hazard Communication standards and does not necessarily imply the existence of a welding hazard. The product may contain additional non-hazardous ingredients or may form additional compounds under the condition of use. Refer to Sections 2 and 8 for more information.





#### 4. FIRST AID MEASURES

**Ingestion:** Avoid hand, clothing, food, and drink contact with fluxes, metal fume or

powder which can cause ingestion of particulate during hand to mouth activities such as drinking, eating, smoking, etc. If ingested, do not induce vomiting. Contact a poison control center. Unless the poison control center advises otherwise, wash out mouth thoroughly with water. If symptoms

develop, seek medical attention at once.

**Inhalation:** Move to fresh air if breathing is difficult. If breathing has stopped, perform

artificial respiration and obtain medical assistance at once.

**Skin Contact:** Remove contaminated clothing and wash the skin thoroughly with soap and

water. For reddened or blistered skin, or thermal burns, obtain medical

assistance at once.

**Eye contact:** Dust or fume from this product should be flushed from the eyes with

copious amounts of clean, tepid water until transported to an emergency medical facility. Do not allow victim to rub or keep eyes tightly closed.

Obtain medical assistance at once.

Arc rays can injure eyes. If exposed to arc rays, move victim to dark room, remove contact lenses as necessary for treatment, cover eyes with a padded dressing and rest. Obtain medical assistance if symptoms persist.

#### Most important symptoms/effects, acute and delayed

Symptoms:

Short-term (acute) overexposure to fumes and gases from welding and allied processes may result in discomfort such as metal fume fever, dizziness, nausea, or dryness or irritation of nose, throat, or eyes. May aggravate pre-existing respiratory problems (e.g. asthma, emphysema). Long-term (chronic) overexposure to fumes and gases from welding and allied processes can lead to siderosis (iron deposits in lung), central nervous system effects, bronchitis and other pulmonary effects. Refer to

Section 11 for more information.

**Hazards:** The hazards associated with welding and its allied processes such as

soldering and brazing are complex and may include physical and health hazards such as but not limited to electric shock, physical strains, radiation burns (eye flash), thermal burns due to hot metal or spatter and potential health effects of overexposure to fumes, gases or dusts potentially generated during the use of this product. Refer to Section 11 for more

information.

# Indication of immediate medical attention and special treatment needed

**Treatment:** Treat symptomatically.

## 5. FIRE-FIGHTING MEASURES

**General Fire Hazards:** As shipped, this product is nonflammable. However, welding arc and

sparks as well as open flames and hot surfaces associated with brazing and soldering can ignite combustible and flammable materials. Read and understand American National Standard Z49.1, "Safety in Welding, Cutting and Allied Processes" and National Fire Protection Association NFPA 51B, "Standard for Fire Prevention during Welding, Cutting and Other Hot Work"

before using this product.

## Suitable (and unsuitable) extinguishing media

**Suitable extinguishing media:** As shipped, the product will not burn. In case of fire in the surroundings:





use appropriate extinguishing agent.

Unsuitable extinguishing media:

Do not use water jet as an extinguisher, as this will spread the fire.

Specific hazards arising from the chemical:

Welding arc and sparks can ignite combustibles and flammable products.

Special protective equipment and precautions for firefighters

Special fire fighting procedures:

Use standard firefighting procedures and consider the hazards of other

involved materials.

Special protective equipment

for fire-fighters:

Selection of respiratory protection for fire fighting: follow the general fire precautions indicated in the workplace. Self-contained breathing apparatus

and full protective clothing must be worn in case of fire.

# 6. ACCIDENTAL RELEASE MEASURES

Personal precautions, protective equipment and emergency procedures:

If airborne dust and/or fume is present, use adequate engineering controls and, if needed, personal protection to prevent overexposure. Refer to recommendations in Section 8.

Methods and material for containment and cleaning up:

Absorb with sand or other inert absorbent. Stop the flow of material, if this is without risk. Clean up spills immediately, observing precautions in the personal protective equipment in Section 8. Avoid generating dust. Prevent product from entering any drains, sewers or water sources. Refer to Section 13 for proper disposal.

**Environmental Precautions:** 

Avoid release to the environment. Prevent further leakage or spillage if safe to do so. Do not contaminate water sources or sewer. Environmental manager must be informed of all major spillages.

# 7. HANDLING AND STORAGE

Precautions for safe handling:

Prevent formation of dust. Provide appropriate exhaust ventilation at places where dust is formed.

Read and understand the manufacturer's instruction and the precautionary label on the product. Refer to Lincoln Safety Publications at www.lincolnelectric.com/safety. See American National Standard Z49.1, "Safety In Welding, Cutting and Allied Processes" published by the American Welding Society, http://pubs.aws.org and OSHA Publication 2206

(29CFR1910), U.S. Government Printing Office, www.gpo.gov.

Conditions for safe storage, including any incompatibilities:

Store in closed original container in a dry place. Store in accordance with local/regional/national regulations. Store away from incompatible materials.

## 8. EXPOSURE CONTROLS / PERSONAL PROTECTION

## **Control Parameters**

**Occupational Exposure Limits: US** 

ocupational Exposuro Elimito. Co				
Chemical Identity	Туре	Exposure Limit Values	Source	
Barium fluoride - as Ba	TWA	0.5 mg/m3	US. ACGIH Threshold Limit Values (12 2010)	
Barium fluoride - as F	TWA	2.5 mg/m3	US. ACGIH Threshold Limit Values (12 2010)	



Barium fluoride - as Ba	REL	0.5 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Barium fluoride - as F	REL	2.5 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Barium fluoride - as Ba	PEL	0.5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Barium fluoride - as F	PEL	2.5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Barium fluoride - Dust.	TWA	2.5 mg/m3	US. OSHA Table Z-2 (29 CFR 1910.1000) (02 2006)
Aluminum and/or aluminum alloys (as Al) - Respirable fraction.	TWA	1 mg/m3	US. ACGIH Threshold Limit Values (12 2010)
Aluminum and/or aluminum alloys (as Al) - Total dust as Al	PEL	15 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Aluminum and/or aluminum alloys (as Al) - Welding fume or pyrophoric powder as Al	REL	5 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Aluminum and/or aluminum alloys (as Al) - Respirable.	REL	5 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Aluminum and/or aluminum alloys (as Al) - Total	REL	10 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Aluminum and/or aluminum alloys (as Al) - Respirable fraction as Al	PEL	5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (03 2016)
Portland cement - Respirable fraction.	TWA	1 mg/m3	US. ACGIH Threshold Limit Values (12 2010)
Portland cement - Total dust.	PEL	15 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Portland cement - Respirable fraction.	PEL	5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Portland cement	TWA	50 millions of particles per cubic foot of air	US. OSHA Table Z-3 (29 CFR 1910.1000) (2000)
Portland cement - Respirable.	REL	5 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Portland cement - Total	REL	10 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Manganese - Fume as Mn	Ceiling	5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
	REL	1 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
	STEL	3 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Manganese - Inhalable fraction as Mn	TWA	0.1 mg/m3	US. ACGIH Threshold Limit Values (03 2014)
Manganese - Respirable fraction as Mn	TWA	0.02 mg/m3	US. ACGIH Threshold Limit Values (03 2014)
Lithium fluoride - as F	TWA	2.5 mg/m3	US. ACGIH Threshold Limit Values (12 2010)
	REL	2.5 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
	PEL	2.5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Lithium fluoride - Dust.	TWA	2.5 mg/m3	US. OSHA Table Z-2 (29 CFR 1910.1000) (02 2006)
Potassium fluorosilicate - as F	TWA	2.5 mg/m3	US. ACGIH Threshold Limit Values (12 2010)
	REL	2.5 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
	PEL	2.5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)



Potassium fluorosilicate - Dust.	TWA	2.5 mg/m3	US. OSHA Table Z-2 (29 CFR 1910.1000) (02 2006)
Silicon - Total dust.	PEL	15 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Silicon - Respirable fraction.	PEL	5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Silicon - Respirable.	REL	5 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Silicon - Total	REL	10 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)

**Occupational Exposure Limits: Canada** 

Chemical Identity	Туре	<b>Exposure Limit Values</b>	Source
Barium fluoride - as Ba	TWA	0.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
Barium fluoride - as F	TWA	2.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	2.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
Barium fluoride - as Ba	TWA	0.5 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
Barium fluoride - as F	TWA	2.5 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	2.5 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
Barium fluoride - as Ba	TWA	0.5 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
Barium fluoride - as F	TWA	2.5 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
Barium fluoride - as Ba	TWA	0.5 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
Barium fluoride - as F	8 HR ACL	2.5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Barium fluoride - as Ba	8 HR ACL	0.5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Barium fluoride - as F	15 MIN ACL	5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Barium fluoride - as Ba	15 MIN ACL	1.5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	TWA	0.5 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Barium fluoride - as F	TWA	2.5 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Aluminum and/or aluminum alloys (as Al) - Pyrophoric powder as Al	TWA	5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
Aluminum and/or aluminum alloys (as Al) - Dust.	TWA	10 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table



			2) (07 2009)
Aluminum and/or aluminum alloys (as Al) - Respirable.	TWA	1 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
Aluminum and/or aluminum alloys (as Al) - Respirable fraction.	TWA	1 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
	TWA	1 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
Aluminum and/or aluminum alloys (as Al) - Pyrophoric powder as Al	8 HR ACL	5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Aluminum and/or aluminum alloys (as Al) - Dust as Al	8 HR ACL	10 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Aluminum and/or aluminum alloys (as Al) - Pyrophoric powder as Al	15 MIN ACL	10 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Aluminum and/or aluminum alloys (as Al) - Dust as Al	15 MIN ACL	20 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Aluminum and/or aluminum alloys (as Al)	TWA	10 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Aluminum and/or aluminum alloys (as Al) - as Al	TWA	5 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Aluminum and/or aluminum alloys (as Al) - Welding fume as Al	TWA	5 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Portland cement	TWA	10 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
Portland cement - Respirable fraction.	TWA	1 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
Portland cement	8 HR ACL	10 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL	20 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Portland cement - Total dust.	TWA	10 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Portland cement - Respirable dust.	TWA	5 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Portland cement - Respirable fraction.	TWA	1 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (06 2015)
Portland cement - Respirable.	TWA	1 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (06 2017)
Manganese - as Mn	TWA	0.2 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	0.2 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	8 HR ACL	0.2 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN	0.6 mg/m3	Canada. Saskatchewan OELs



	ACL		(Occupational Health and Safety
			Regulations, 1996, Table 21) (05 2009)
Manganese - Respirable fraction as Mn	TWA	0.02 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2014)
Manganese - Inhalable fraction as Mn	TWA	0.1 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2014)
Manganese - as Mn	TWA	0.2 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical
Manganese - Fume, total dust as Mn	TWA	0.2 mg/m3	Agents) (06 2015)  Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the
Lithium fluoride - as F	TWA	2.5 mg/m3	Work Environment) (09 2017)  Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table
			2) (07 2009)
	TWA	2.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	2.5 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as
	TWA	2.5 mg/m3	amended) (07 2007)  Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
	TWA	2.5 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
	8 HR ACL	2.5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL	5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	TWA	2.5 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Potassium fluorosilicate - as F	TWA	2.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	2.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	2.5 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	2.5 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
	TWA	2.5 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
	8 HR ACL	2.5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL	5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	TWA	2.5 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (12 2008)
Silicon - Total dust.	TWA	10 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (07 2010)
Silicon	8 HR ACL	10 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety



			Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL	20 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Silicon - Total dust.	TWA	10 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)

**Occupational Exposure Limits: Mexico** 


Chemical Identity	Туре	Exposure Limit Values	Source
Iron - as Fe	VLE-PPT	1 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Barium fluoride - as F	VLE-PPT	2.5 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Barium fluoride - as Ba	VLE-PPT	0.5 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Aluminum and/or aluminum alloys (as Al) - Respirable fraction.	VLE-PPT	1 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Portland cement - Respirable fraction.	VLE-PPT	1 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Manganese - as Mn	VLE-PPT	0.2 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Lithium fluoride - as F	VLE-PPT	2.5 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Potassium fluorosilicate - as F	VLE-PPT	2.5 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)

**Biological Limit Values: US** 

Chemical Identity	Exposure Limit Values	Source
Barium fluoride (Fluoride:	2 mg/l (Urine)	ACGIH BEI (03 2013)
Sampling time: Prior to shift.)		
Barium fluoride (Fluoride:	3 mg/l (Urine)	ACGIH BEI (03 2013)
Sampling time: End of shift.)		
Lithium fluoride (Fluoride:	2 mg/l (Urine)	ACGIH BEI (03 2013)
Sampling time: Prior to shift.)		
Lithium fluoride (Fluoride:	3 mg/l (Urine)	ACGIH BEI (03 2013)
Sampling time: End of shift.)		
Potassium fluorosilicate	2 mg/l (Urine)	ACGIH BEI (03 2013)
(Fluoride: Sampling time:		
Prior to shift.)		
Potassium fluorosilicate	3 mg/l (Urine)	ACGIH BEI (03 2013)
(Fluoride: Sampling time:		
End of shift.)		

**Biological Limit Values: Mexico** 

Chemical Identity	Exposure Limit Values	Source
Barium fluoride (fluorides: Sampling time: End of shift.)	10 mg/g (Creatinine in urine)	MX IBE (06 2012)
Barium fluoride (fluorides: Sampling time: Prior to shift.)	3 mg/g (Creatinine in urine)	MX IBE (06 2012)
Lithium fluoride (fluorides: Sampling time: End of shift.)	10 mg/g (Creatinine in urine)	MX IBE (06 2012)
Lithium fluoride (fluorides: Sampling time: Prior to shift.)	3 mg/g (Creatinine in urine)	MX IBE (06 2012)
Potassium fluorosilicate (fluorides: Sampling time: Prior to shift.)	3 mg/g (Creatinine in urine)	MX IBE (06 2012)

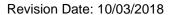



Potassium fluorosilicate	10 mg/g (Creatinine in urine) MX IBE (06 2012)
(fluorides: Sampling time:	
End of shift.)	

Additional exposure limits under the conditions of use: US

Chemical Identity	Туре	Exposure Li	mit Values	Source
Carbon dioxide	TWA	5,000 ppm		US. ACGIH Threshold Limit Values (12 2010)
	STEL	30,000 ppm		US. ACGIH Threshold Limit Values (12 2010)
	PEL	5,000 ppm	9,000 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
	STEL	30,000 ppm	54,000 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
	REL	5,000 ppm	9,000 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Carbon monoxide	TWA	25 ppm		US. ACGIH Threshold Limit Values (12 2010)
	PEL	50 ppm	55 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
	REL	35 ppm	40 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
	Ceil_Time	200 ppm	229 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Nitrogen dioxide	TWA	0.2 ppm		US. ACGIH Threshold Limit Values (02 2012)
	Ceiling	5 ppm	9 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
	STEL	1 ppm	1.8 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Ozone	PEL	0.1 ppm	0.2 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
	Ceil_Time	0.1 ppm	0.2 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
	TWA	0.05 ppm		US. ACGIH Threshold Limit Values (03 2014)
	TWA	0.20 ppm		US. ACGIH Threshold Limit Values (03 2014)
	TWA	0.10 ppm		US. ACGIH Threshold Limit Values (03 2014)
	TWA	0.08 ppm		US. ACGIH Threshold Limit Values (03 2014)
Manganese - Fume as Mn	Ceiling		5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
	REL		1 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
	STEL		3 mg/m3	US. NIOSH: Pocket Guide to Chemical Hazards (2005)
Manganese - Inhalable fraction as Mn	TWA		0.1 mg/m3	US. ACGIH Threshold Limit Values (03 2014)
Manganese - Respirable fraction as Mn	TWA		0.02 mg/m3	US. ACGIH Threshold Limit Values (03 2014)
Barium and soluble compounds (as Ba) - as Ba	TWA		0.5 mg/m3	US. ACGIH Threshold Limit Values (12 2010)
	PEL		0.5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (01 2017)
Fluorides (as F) - as F	TWA		2.5 mg/m3	US. ACGIH Threshold Limit Values (12 2010)
	PEL		2.5 mg/m3	US. OSHA Table Z-1 Limits for Air Contaminants (29 CFR 1910.1000) (02 2006)
Fluorides (as F) - Dust.	TWA		2.5 mg/m3	US. OSHA Table Z-2 (29 CFR 1910.100





(02 2006)

Additional exposure limits under the conditions of use: Canada

Chemical Identity	Туре	Exposure Limit Values		Source
Carbon dioxide	STEL	30,000 ppm	54,000 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	5,000 ppm	9,000 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	5,000 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	STEL	15,000 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	5,000 ppm		Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
	STEL	30,000 ppm		Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
	STEL	30,000 ppm		Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
	TWA	5,000 ppm		Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
	8 HR ACL	5,000 ppm		Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL	30,000 ppm		Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	TWA	5,000 ppm	9,000 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
	STEL	30,000 ppm	54,000 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Carbon monoxide	TWA	25 ppm	29 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	25 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	STEL	100 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	25 ppm		Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
	TWA	25 ppm		Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (07 2010)
	8 HR ACL	25 ppm		Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL	190 ppm		Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)



	TWA	35 ppm	40 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
	STEL	200 ppm	230 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Nitrogen dioxide	STEL	5 ppm	9.4 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	3 ppm	5.6 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	CEILING	1 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	0.2 ppm		Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2012)
	STEL	5 ppm		Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
	TWA	3 ppm		Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
	8 HR ACL	3 ppm		Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL	5 ppm		Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	TWA	3 ppm	5.6 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Ozone	STEL	0.3 ppm	0.6 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	0.1 ppm	0.2 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA	0.05 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	0.1 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	0.08 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	0.2 ppm		Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA	0.1 ppm	0.2 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (07 2010)
	STEL	0.3 ppm	0.6 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (07 2010)
	15 MIN ACL	0.15 ppm		Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
-	8 HR ACL	0.05 ppm		Canada. Saskatchewan OELs



				(Occupational Health and Safety
				Regulations, 1996, Table 21) (05 2009)
	CEILING	0.1 ppm	0.2 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (12 2008)
	TWA	0.20 ppm		Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2014)
	TWA	0.05 ppm		Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2014)
	TWA	0.08 ppm		Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2014)
	TWA	0.10 ppm		Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2014)
Manganese - as Mn	TWA		0.2 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA		0.2 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	8 HR ACL		0.2 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL		0.6 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Manganese - Respirable fraction as Mn	TWA		0.02 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2014)
Manganese - Inhalable fraction as Mn	TWA		0.1 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2014)
Manganese - as Mn	TWA		0.2 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (06 2015)
Manganese - Fume, total dust as Mn	TWA		0.2 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)
Barium and soluble compounds (as Ba) - as Ba	TWA		0.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA		0.5 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
	TWA		0.5 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
	TWA		0.5 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
	8 HR ACL		0.5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
	15 MIN ACL		1.5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
Fluorides (as F) - as F	TWA		2.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA		2.5 mg/m3	Canada. Alberta OELs (Occupational Health & Safety Code, Schedule 1, Table 2) (07 2009)
	TWA		2.5 mg/m3	Canada. British Columbia OELs. (Occupational Exposure Limits for



		Chemical Substances, Occupational Health and Safety Regulation 296/97, as amended) (07 2007)
TWA	2.5 mg/m3	Canada. Manitoba OELs (Reg. 217/2006, The Workplace Safety And Health Act) (03 2011)
TWA	2.5 mg/m3	Canada. Ontario OELs. (Control of Exposure to Biological or Chemical Agents) (11 2010)
8 HR ACL	2.5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
15 MIN ACL	5 mg/m3	Canada. Saskatchewan OELs (Occupational Health and Safety Regulations, 1996, Table 21) (05 2009)
TWA	2.5 mg/m3	Canada. Quebec OELs. (Ministry of Labor - Regulation Respecting the Quality of the Work Environment) (09 2017)

Additional exposure limits under the conditions of use: Mexico

Chemical Identity	Туре	Exposure Limit Values	Source
Carbon dioxide	VLE-CT	30,000 ppm	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
	VLE-PPT	5,000 ppm	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Carbon monoxide	VLE-PPT	25 ppm	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Nitrogen dioxide	VLE-PPT	0.2 ppm	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Ozone	VLE-P	0.1 ppm	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Manganese - as Mn	VLE-PPT	0.2 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Barium and soluble compounds (as Ba) - as Ba	VLE-PPT	0.5 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)
Fluorides (as F) - as F	VLE-PPT	2.5 mg/m3	Mexico. OELs. (NOM-010-STPS-2014 Chemical Pollutants at the Workplace; Assessment and Control) (04 2014)

# Appropriate Engineering Controls

**Ventilation:** Use enough ventilation and local exhaust at the arc, flame or heat source to keep the fumes and gases from the worker's breathing zone and the general area. Train the operator to keep their head out of the fumes. **Keep exposure as low as possible.** 

# Individual protection measures, such as personal protective equipment General information: Exposure Guidelines: To reduce the po

Exposure Guidelines: To reduce the potential for overexposure, use controls such as adequate ventilation and personal protective equipment (PPE). Overexposure refers to exceeding applicable local limits, the American Conference of Governmental Industrial Hygienists (ACGIH) Threshold Limit Values (TLVs) or the Occupational Safety and Health Administration's (OSHA) Permissible Exposure Limits (PELs). Workplace exposure levels should be established by competent industrial hygiene assessments. Unless exposure levels are confirmed to be below the applicable local limit, TLV or PEL, whichever is lower, respirator use is required. Absent these controls, overexposure to one or more compound constituents, including those in the fume or airborne particles, may occur resulting in potential health hazards. According to the ACGIH, TLVs and Biological Exposure Indices (BEIs) "represent conditions under which





ACGIH believes that nearly all workers may be repeatedly exposed without adverse health effects." The ACGIH further states that the TLV-TWA should be used as a guide in the control of health hazards and should not be used to indicate a fine line between safe and dangerous exposures. See Section 10 for information on constituents which have some potential to present health hazards. Welding consumables and materials being joined may contain chromium as an unintended trace element. Materials that contain chromium may produce some amount of hexavalent chromium (CrVI) and other chromium compounds as a byproduct in the fume. In 2018, the American Conference of Governmental Industrial Hygienists (ACGIH) lowered the Threshold Limit Value (TLV) for hexavalent chromium from 50 micrograms per cubic meter of air (50 µg/m³) to 0.2 µg/m³. At these new limits, CrVI exposures at or above the TLV may be possible in cases where adequate ventilation is not provided. CrVI compounds are on the IARC and NTP lists as posing a lung cancer and sinus cancer risk. Workplace conditions are unique and welding fume exposures levels vary. Workplace exposure assessments must be conducted by a qualified professional, such as an industrial hygienist, to determine if exposures are below applicable limits and to make recommendations when necessary for preventing overexposures.

Eye/face protection:

Wear helmet or use face shield with filter lens shade number 12 or darker for open arc processes – or follow the recommendations as specified in ANSI Z49.1, Section 4, based on your process and settings. No specific lens shade recommendation for submerged arc or electroslag processes. Shield others by providing appropriate screens and flash goggles.

Skin Protection
Hand Protection:

Wear protective gloves. Suitable gloves can be recommended by the glove supplier.

Other:

**Protective Clothing:** Wear hand, head, and body protection which help to prevent injury from radiation, open flames, hot surfaces, sparks and electrical shock. See Z49.1. At a minimum, this includes welder's gloves and a protective face shield when welding, and may include arm protectors, aprons, hats, shoulder protection, as well as dark substantial clothing when welding, brazing and soldering. Wear dry gloves free of holes or split seams. Train the operator not to permit electrically live parts or electrodes from contacting the skin . . . or clothing or gloves if they are wet. Insulate yourself from the work piece and ground using dry plywood, rubber mats or other dry insulation.

**Respiratory Protection:** 

Keep your head out of fumes. Use enough ventilation and local exhaust to keep fumes and gases from your breathing zone and the general area. An approved respirator should be used unless exposure assessments are below applicable exposure limits.

Hygiene measures:

Do not eat, drink or smoke when using the product. Always observe good personal hygiene measures, such as washing after handling the material and before eating, drinking, and/or smoking. Routinely wash work clothing and protective equipment to remove contaminants. Determine the composition and quantity of fumes and gases to which workers are exposed by taking an air sample from inside the welder's helmet if worn or in the worker's breathing zone. Improve ventilation if exposures are not below limits. See ANSI/AWS F1.1, F1.2, F1.3 and F1.5, available from the American Welding Society, www.aws.org.

#### 9. PHYSICAL AND CHEMICAL PROPERTIES





**Appearance:** Cored welding wire.

Physical state: Solid Form: Solid

Color:

Odor:

No data available.

range:

No data available. Flash Point: **Evaporation rate:** No data available. Flammability (solid, gas): No data available. Upper/lower limit on flammability or explosive limits Flammability limit - upper (%): No data available. Flammability limit - lower (%): No data available. Explosive limit - upper (%): No data available. **Explosive limit - lower (%):** No data available. No data available. Vapor pressure: No data available. Vapor density: Density: No data available. Relative density: No data available.

Solubility(ies)

Solubility in water:

Solubility (other):

Partition coefficient (n
No data available.

No data available.

octanol/water):

Auto-ignition temperature: No data available.

Decomposition temperature: No data available.

Viscosity: No data available.

# 10. STABILITY AND REACTIVITY

Reactivity: The product is non-reactive under normal conditions of use, storage and

transport.

**Chemical Stability:** Material is stable under normal conditions.

Possibility of hazardous

reactions:

None under normal conditions.

**Conditions to avoid:** Avoid heat or contamination.

**Incompatible Materials:** Strong acids. Strong oxidizing substances. Strong bases.

**Hazardous Decomposition** 

**Products:** 

Fumes and gases from welding and its allied processes such as brazing and soldering cannot be classified simply. The composition and quantity of both are dependent upon the metal to which the joining or hot work is applied, the process, procedure - and where applicable - the electrode or consumable used. Other conditions which also influence the composition





and quantity of the fumes and gases to which workers may be exposed include: coatings on the metal being welded or worked (such as paint, plating, or galvanizing), the number of operators and the volume of the work area, the quality and amount of ventilation, the position of the operator's head with respect to the fume plume, as well as the presence of contaminants in the atmosphere (such as chlorinated hydrocarbon vapors from cleaning and degreasing activities.)

In cases where an electrode or other applied material is consumed, the fume and gas decomposition products generated are different in percent and form from the ingredients listed in Section 3. Decomposition products of normal operation include those originating from the volatilization, reaction, or oxidation of the materials shown in Section 3, plus those from the base metal and coating, etc., as noted above. Reasonably expected fume constituents produced during arc welding and brazing include the oxides of iron, manganese and other metals present in the welding consumable or base metal. Hexavalent chromium compounds may be in the welding or brazing fume of consumables or base metals which contain chromium. Gaseous and particulate fluoride may be in the fume of consumables or flux materials which contain fluoride. Gaseous reaction products may include carbon monoxide and carbon dioxide. Ozone and nitrogen oxides may be formed by the radiation from the arc associated with welding.

#### 11. TOXICOLOGICAL INFORMATION

#### General information:

The International Agency for Research on Cancer (IARC) has determined welding fumes and ultraviolet radiation from welding are carcinogenic to humans (Group 1). According to IARC, welding fumes cause cancer of the lung and positive associations have been observed with cancer of the kidney. Also according to IARC, ultraviolet radiation from welding causes ocular melanoma. IARC identifies gouging, brazing, carbon arc or plasma arc cutting, and soldering as processes closely related to welding. Read and understand the manufacturer's instructions, Safety Data Sheets and the precautionary labels before using this product.

#### Information on likely routes of exposure

**Inhalation:** Potential chronic health hazards related to the use of welding consumables

are most applicable to the inhalation route of exposure. Refer to Inhalation

statements in Section 11.

**Skin Contact:** Arc rays can burn skin. Skin cancer has been reported.

**Eye contact:** Arc rays can injure eyes.

**Ingestion:** Health injuries from ingestion are not known or expected under normal use.

## Symptoms related to the physical, chemical and toxicological characteristics

**Inhalation:** Short-term (acute) overexposure to fumes and gases from welding and

allied processes may result in discomfort such as metal fume fever, dizziness, nausea, or dryness or irritation of nose, throat, or eyes. May aggravate pre-existing respiratory problems (e.g. asthma, emphysema). Long-term (chronic) overexposure to fumes and gases from welding and allied processes can lead to siderosis (iron deposits in lung), central

nervous system effects, bronchitis and other pulmonary effects.

## Information on toxicological effects





Acute toxicity (list all possible routes of exposure)

Oral

Product: Not classified

Specified substance(s):

Iron LD 50 (Rat): 98.6 g/kg
Barium fluoride LD 50 (Rat): 250 mg/kg
Lithium fluoride LD 50 (Rat): 143 mg/kg
Potassium fluorosilicate LD 50 (Rat): 114 mg/kg

Dermal

Product: Not classified

Inhalation

Product: Not classified

Specified substance(s):

Aluminum and/or LC 50 (Rat, 1 h): 7.6 mg/l

aluminum alloys (as Al)

Potassium fluorosilicate LC 50 (Rat, 4 h): 2.021 mg/l

Repeated dose toxicity

Product: Not classified

Skin Corrosion/Irritation

Product: Not classified

Serious Eye Damage/Eye Irritation

**Product:** Not classified

Respiratory or Skin Sensitization

Product: Not classified

Carcinogenicity

**Product:** Arc rays: Skin cancer has been reported.

IARC Monographs on the Evaluation of Carcinogenic Risks to Humans:

No carcinogenic components identified

**US. National Toxicology Program (NTP) Report on Carcinogens:** 

No carcinogenic components identified

US. OSHA Specifically Regulated Substances (29 CFR 1910.1001-1050):

No carcinogenic components identified

**Germ Cell Mutagenicity** 

In vitro

**Product:** Not classified

In vivo

Product: Not classified

Reproductive toxicity

Product: Not classified

**Specific Target Organ Toxicity - Single Exposure** 

Product: Not classified

Specific Target Organ Toxicity - Repeated Exposure

Product: Not classified





**Aspiration Hazard** 

Product: Not classified

Other effects: Organic polymers may be used in the manufacture of various welding

consumables. Overexposure to their decomposition byproducts may result in a condition known as polymer fume fever. Polymer fume fever usually occurs within 4 to 8 hours of exposure with the presentation of flu like symptoms, including mild pulmonary irritation with or without an increase in body temperature. Signs of exposure can include an increase in white blood cell count. Resolution of symptoms typically occurs quickly, usually

not lasting longer than 48 hours.

Symptoms related to the physical, chemical and toxicological characteristics under the condition of use

Inhalation:

Specified substance(s):

Manganese Overexposure to manganese fumes may affect the brain and central

nervous system, resulting in poor coordination, difficulty speaking, and arm

or leg tremor. This condition can be irreversible.

Barium and soluble compounds (as Ba)

Overexposure to soluble barium compounds may cause severe stomach pain, slow pulse rate, irregular heartbeat, convulsions, and muscle spasms.

Additional toxicological Information under the conditions of use:

**Acute toxicity** 

Oral

Specified substance(s):

Barium and soluble LD 50 (Rat): 630 mg/kg

compounds (as Ba)

Fluorides (as F) LD 50 (Rat): 4,250 mg/kg

Inhalation

Specified substance(s):

Carbon dioxide LC Lo (Human, 5 min): 90000 ppm

Carbon monoxide LC 50 (Rat, 4 h): 1300 ppm Nitrogen dioxide LC 50 (Rat, 4 h): 88 ppm

Ozone LC Lo (Human, 30 min): 50 ppm

Other effects:

Specified substance(s):

Carbon dioxide Asphyxia

Carbon monoxide Carboxyhemoglobinemia
Nitrogen dioxide Lower respiratory tract irritation

Barium and soluble Skin irritation Muscular stimulation Eye irritation Gastro-intestinal tract

compounds (as Ba) irritation

12. ECOLOGICAL INFORMATION

**Ecotoxicity** 

Acute hazards to the aquatic environment:

**Fish** 

Product: Not classified

Specified substance(s):

Aluminum and/or LC 50 (Grass carp, white amur (Ctenopharyngodon idella), 96 h): 0.21 -

aluminum alloys (as Al) 0.31 mg/l

Aquatic Invertebrates

Product: Not classified





Specified substance(s):

Manganese EC 50 (Water flea (Daphnia magna), 48 h): 40 mg/l

Chronic hazards to the aquatic environment:

Fish

Product: Not classified

**Aquatic Invertebrates** 

Product: Not classified

**Toxicity to Aquatic Plants** 

Product: Not classified

**Persistence and Degradability** 

Biodegradation

**Product:** No data available.

Bioaccumulative potential

**Bioconcentration Factor (BCF)** 

**Product:** No data available.

**Mobility in soil:** No data available.

# 13. DISPOSAL CONSIDERATIONS

**General information:** The generation of waste should be avoided or minimized whenever

possible. When practical, recycle in an environmentally acceptable, regulatory compliant manner. Dispose of non-recyclable products in accordance with all applicable Federal, State, Provincial, and Local

requirements.

**Disposal instructions:** Disposal of this product may be regulated as a Hazardous Waste. The

welding consumable and/or by-product from the welding process (including, but not limited to slag, dust, etc.) may contain levels of leachable heavy metals such as Barium or Chromium. Prior to disposal, a representative

sample must be analyzed in accordance with US EPA's Toxicity

Characteristic Leaching Procedure (TCLP) to determine if any constituents exist above regulated threshold levels. Discard any product, residue, disposable container, or liner in an environmentally acceptable manner

according to Federal, State and Local Regulations.

**Contaminated Packaging:** Dispose of contents/container to an appropriate treatment and disposal

facility in accordance with applicable laws and regulations, and product

characteristics at time of disposal.

## 14. TRANSPORT INFORMATION

DOT

**UN Number:** 

UN Proper Shipping Name: NOT DG REGULATED

Transport Hazard Class(es)

Class: NR
Label(s): –
Packing Group: –
Marine Pollutant: No

**IMDG** 





**UN Number:** 

UN Proper Shipping Name: NOT DG REGULATED

Transport Hazard Class(es)

Class: NR Label(s): –

EmS No.:

Packing Group: –
Marine Pollutant: No

IATA

UN Number:

Proper Shipping Name: NOT DG REGULATED

Transport Hazard Class(es):

Class: NR
Label(s): Packing Group: Marine Pollutant: No
Cargo aircraft only: Allowed.

**TDG** 

**UN Number:** 

UN Proper Shipping Name: NOT DG REGULATED

Transport Hazard Class(es)

Class: NR
Label(s): –
Packing Group: –
Marine Pollutant: No

# 15. REGULATORY INFORMATION

## **US Federal Regulations**

#### TSCA Section 12(b) Export Notification (40 CFR 707, Subpt. D)

None present or none present in regulated quantities.

#### US. OSHA Specifically Regulated Substances (29 CFR 1910.1001-1050)

None present or none present in regulated quantities.

### CERCLA Hazardous Substance List (40 CFR 302.4):

Chemical Identity Reportable quantity

Manganese Included in the regulation but with no data values. See

regulation for further details.

# Superfund Amendments and Reauthorization Act of 1986 (SARA)

Hazard categories Not classified

Not classified

#### **SARA 302 Extremely Hazardous Substance**

None present or none present in regulated quantities.

# **SARA 304 Emergency Release Notification**

Chemical Identity Reportable quantity

Manganese Included in the regulation but with no data values. See

regulation for further details.

SARA 311/312 Hazardous Chemical

<u>Chemical Identity</u> <u>Threshold Planning Quantity</u>



Iron	10000 lbs
Barium fluoride	10000 lbs
Aluminum and/or aluminum alloys (as	10000 lbs
AI)	
Portland cement	10000 lbs
Magnesium	10000 lbs
Manganese	10000 lbs
Lithium fluoride	10000 lbs
Potassium fluorosilicate	10000 lbs
Silicon	10000 lbs

#### SARA 313 (TRI Reporting)

,	Reporting threshold	Reporting threshold for
Chemical Identity	for other users	manufacturing and processing
Barium fluoride	10000 lbs	25000 lbs.
Aluminum and/or aluminum alloys (as	10000 lbs	25000 lbs.

#### Clean Water Act Section 311 Hazardous Substances (40 CFR 117.3)

None present or none present in regulated quantities.

#### Clean Air Act (CAA) Section 112(r) Accidental Release Prevention (40 CFR 68.130):

None present or none present in regulated quantities.

#### **US State Regulations**

## **US. California Proposition 65**

No ingredient regulated by CA Prop 65 present.

WARNING: This product contains or produces a chemical known to the State of California to cause cancer and

birth defects (or other reproductive harm). (California Health & Safety Code Section 25249.5 et seq.)

WARNING: Cancer and Reproductive Harm - www.P65Warnings.ca.gov

# US. New Jersey Worker and Community Right-to-Know Act Chemical Identity

Barium fluoride

Aluminum and/or aluminum alloys (as Al)

#### **US. Massachusetts RTK - Substance List**

No ingredient regulated by MA Right-to-Know Law present.

## US. Pennsylvania RTK - Hazardous Substances

#### **Chemical Identity**

Barium fluoride

Aluminum and/or aluminum alloys (as Al)

#### **US. Rhode Island RTK**

No ingredient regulated by RI Right-to-Know Law present.

#### **Canada Federal Regulations**

List of Toxic Substances (CEPA, Schedule 1)

### **Chemical Identity**

Barium fluoride
Aluminum and/or
aluminum alloys (as Al)
Lithium fluoride
Potassium fluorosilicate

## Export Control List (CEPA 1999, Schedule 3)





Not Regulated

### **National Pollutant Release Inventory (NPRI)**

Canada. National Pollutant Release Inventory (NPRI) Substances, Part 5, VOCs with Additional Reporting Requirements

NPRI PT5 Not Regulated

Canada. National Pollutant Release Inventory (NPRI) (Schedule 1, Parts 1-4)

NPRI Not Regulated

#### **Greenhouse Gases**

Not Regulated

#### **Controlled Drugs and Substances Act**

CA CDSI Not Regulated
CA CDSII Not Regulated
CA CDSIII Not Regulated
CA CDSIV Not Regulated
CA CDSV Not Regulated
CA CDSVII Not Regulated
CA CDSVIII Not Regulated
CA CDSVIII Not Regulated

#### **Precursor Control Regulations**

Not Regulated

Mexico. Substances subject to reporting for the pollutant release and transfer registry (PRTR): Not applicable

#### **Inventory Status:**

Australia AICS:

Canada DSL Inventory List:

EINECS, ELINCS or NLP:

On or in compliance with the inventory
On or in compliance with the inventory

Japan (ENCS) List: One or more components are not listed or are exempt from listing.

China Inv. Existing Chemical Substances: On or in compliance with the inventory Korea Existing Chemicals Inv. (KECI): On or in compliance with the inventory

Canada NDSL Inventory:

One or more components are not listed or are exempt from listing.

Philippines PICCS:

One or more components are not listed or are exempt from listing.

US TSCA Inventory:

On or in compliance with the inventory

New Zealand Inventory of Chemicals:

On or in compliance with the inventory

Japan ISHL Listing:

One or more components are not listed or are exempt from listing.

Japan Pharmacopoeia Listing:

One or more components are not listed or are exempt from listing.

Mexico INSQ:
Ontario Inventory:
On or in compliance with the inventory

## 16. OTHER INFORMATION

#### **Definitions:**

**Revision Date:** 10/03/2018

**Further Information:** Additional information is available by request.

Disclaimer: The Lincoln Electric Company urges each end user and recipient of this SDS

to study it carefully. See also www.lincolnelectric.com/safety. If necessary,



consult an industrial hygienist or other expert to understand this information and safeguard the environment and protect workers from potential hazards associated with the handling or use of this product. This information is believed to be accurate as of the revision date shown above. However, no warranty, expressed or implied, is given. Because the conditions or methods of use are beyond Lincoln Electric's control, we assume no liability resulting from the use of this product. Regulatory requirements are subject to change and may differ between various locations. Compliance with all applicable Federal, State, Provincial, and local laws and regulations remain the responsibility of the user.

© 2018 Lincoln Global, Inc. All Rights Reserved.